


TECHNICAL NOTES SERIES

JOWETT JAVELIN – PA, PB, PC, PD & PE JOWETT JUPITER – SA & SC

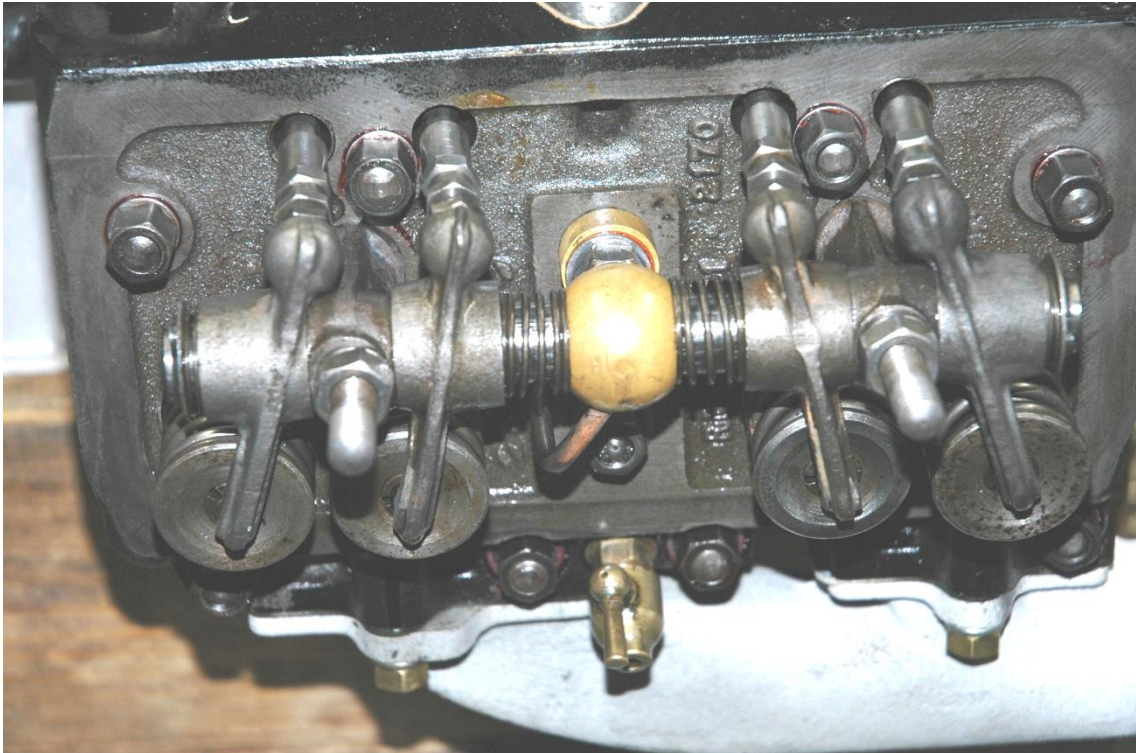

PART XIV – ENGINE VALVE NOISE

The Jowett Car Club of Australia Incorporated is not responsible for any inaccuracies or changes that may occur within this document. Every effort has been made to ensure accuracy. It is not a Jowett Car Club publication and, therefore, the Club has no control over its contents. These Technical Notes have been compiled by using the information that was available, which was deemed accurate at the time.

*Compiled by Mike Alfrey – January, 2006.
Revised – February, 2024.*

CONTENTS

Topic Discussed	Page No.
INTRODUCTORY COMMENT FOR TECHNICAL NOTES	3
VALVE CLEARANCE NOISE – ENGINES WITH SOLID TAPPETS	3
THE CAMSHAFT – GENERAL	4
CAM PROFILE	4
THE CAM FOLLOWERS (TAPPETS)	5
CAMSHAFT FOR HYDRAULIC TAPPETS	5
THE ROCKER ARM ASSEMBLY	5
VALVE CLEARANCE EFFECTS	6
INVESTIGATING VALVE CLEARANCE NOISE	7
FINAL COMMENT	7



WARNING!
ASBESTOS COULD BE PRESENT IN
GASKETS AND FIBRE WASHERS



INTRODUCTORY COMMENT FOR TECHNICAL NOTES

These introductory notes should be read prior to reading Part XIV of the Technical Notes Series.

The Jowett Technical Notes Series have been an ongoing activity for several years. That means that some techniques and specifications may have been superseded in later notes on the same, or associated topics in the series. Also be aware that some topics and recommendations may be specific to certain Engine Serial Number ranges. It appears that, in Australia, the various State Main Agents did not carry out Service Bulletin information during Jowett active times. A set of known Service Bulletins is in Part III.

Some of the notes are restorations of what was written by members of the Jowett Car Club (UK), the Jowett Car Club (NZ) and by members of the JCCA.

Over the years of involvement with matters Jowett, and with the dawning of the personal computer age, a personal decision was made to help members of the Jowett Car Club of Australia Inc. with technical information. Included with the Technical Notes are 'restored' versions of the Javelin and Jupiter Maintenance Manuals and the associated Spare Parts Catalogues. Future generations will prefer to flick through images on their personal device screens, rather than leafing through pages in a tattered and oil stained book to access information.

The term 'restored' has been used because it soon became apparent that, as with our efforts in restoring Jowett vehicles, we desire excellent quality of workmanship in the reproduction of Jowett related documentation. Not for us the crude, and crooked, photocopies that have been issued over the years. These have, even though accurate at their time, become partly out of date.

Hence the decision to 'restore' the publications and documents that have come to hand.

It should be noted that the Javelin and Jupiter Spare Parts Catalogue is a combination of all the catalogues that were to hand (from 1948 to 1953).

The Maintenance Manuals were originally written on the assumption that they would be used by skilled motor mechanics who had attended service training courses conducted by Jowett Cars Limited and after works closure, were made available for owners who had reasonable mechanical knowledge of motor car maintenance and overhaul.

Included with the Technical Notes Series is a Lucas Overseas Correspondence Course, which can be of great assistance when trouble-shooting electrical problems related to your Jowett, or any other British vehicle of the same period.

Please be aware that this is an ongoing project

Mike Allfrey – February, 2024

VALVE CLEARANCE NOISE – ENGINES WITH SOLID TAPPETS

The engines used in Javelin and Jupiter motor cars have, in some cases now, been in use for over sixty years. Others, that have not been in continuous use, have also amassed high mileages. This prodigious amount of use may, by now, have caused some wear at the camshaft bearing journals, and at the bearing bores in the crankcase set. Wear in this area is normal, but minimal – and it can be confirmed by the fact that an engine's valve clearances are noisy, even though their adjustment has been carried out exactly as described in the Jowett Maintenance Manual.

In a push rod actuated over head valve engine, the valve clearance is still commonly referred to as 'tappet clearance' which is technically incorrect. In the Javelin engine the clearance is set at the valve stem to rocker arm tip. This is a different clearance from that between the camshaft lobe and the cam follower (tappet). The Bradford engine does feature adjustable tappets.

This phenomenon of excessive valve clearance noise may have been brought about by several contributing factors:

1. Excessive wear at the valve actuating rocker tip where it contacts the valve stem. This condition makes accurate adjustment of valve clearances with feeler gauges very difficult, if not impossible.
2. Wear at the valve rocker pivot bush and/or rocker shaft.
3. Abnormal wear at a pushrod adjusting ball end.

4. Excessive wear at the valve guides. With the advent of unleaded petrol, this condition is becoming quite common.
5. Bent push rods. A bent push rod can 'clatter' within its tunnel in the cylinder head. A severely bent push rod can flex during operation, causing variances in valve clearance.
6. Loose push rod seats in cam followers.
7. Excessive wear at the camshaft bearing journals.
8. Excessive wear at the camshaft bearing bores in the crankcase set.
9. Excessive wear at the timing chain and the chain wheels (sprockets).

All of the above conditions, excepting the push rod and valve rocker related ones, can also apply to the Bradford engine. It is of great importance that the matter of valve clearance noise be prudently investigated. Excessive rocker tip to valve stem tip clearances can severely affect the life of valve train components.

To understand the above mentioned conditions, each valve train component will be discussed in turn.

The Camshaft – General

The camshaft is driven by a Renold Duplex endless chain from the front of the crankshaft. The camshaft is supported by three bearings located in the top of the crankcase set. The camshaft's bearing journals rotate direct in the cast aluminium bearing bores in the crankcase. There are no bearing slippers (shells).

This type of bearing set up can have an effect on an engine that has operated for a considerable mileage, in that the camshaft bearing journals and bearing bore surfaces can wear. This wear can, ultimately, be heard when the engine is operating at low idle to medium speed as an excessive amount of valve clearance noise. Severe wear at the camshaft bearings can affect the clearance between the rocker arm and the valve tip. It should be appreciated that 0.004-in. wear at the camshaft bearings will translate to 0.006-in. more clearance at the valve stem tip. Hence the alarming noise. The fact that there is valve clearance noise at low idle to medium engine speeds illustrates that the camshaft is oscillating within the bearing bores. Wear in this area can explain an oil pressure concern when the engine has been overhauled. If the engine's main and big end crankshaft bearings are in good condition, and the camshaft bearings are severely worn, oil under pressure will escape from the three bearing journals.

The camshaft, in good condition should have 0.001 – 0.003-in. (0.025 – 0.076 mm) running clearance in the bearing bores. With the later style adjustable peg located in the front timing cover, it should have minimal end float. The bearing bore diameters in the crankcase should be as follows:

Numbers 1, 2 and 3 – 1.501-in. (38.125 mm) diameter.

The repair technique for a worn crankcase can be daunting, but if this is found to be the cause of noise, then something must be done to correct the condition. One option is to have the crankcase line bored so that the bearing bores are larger and true. This can be expensive due to the time required to set-up the crankcase set for the machining activity. Once the bores have been trued in the crankcase, the camshaft bearing journals can be built up and ground to provide 0.001-in. running clearance. At this repair stage, consideration should be given to upgrading the camshaft to provide adjustable end float that, if excessive, can cause a distinctive engine knock. A concern here is cost, expect to pay about \$200.00 per journal. This was the method used to reclaim my Jupiter's crankcase and, to date, has been entirely successful. Jowett Engineering Limited used to bore crankcases and supply oversize camshafts to suit.

Cam Profile

Each camshaft features lobes that have tips that move tappets 0.244-in. (5.69 mm) at maximum valve lift. The common lobe profile has ramps that reduce mechanical noise at initial lift and at the valve's closing point. These profiles must be maintained. The valves do move further open than the lift of the cam lobes, there is added valve movement due to the position of the valve rocker arm pivot – the push rod end is shorter than the valve tip end of the arm.

The Cam Followers (Tappets)

The Javelin engine has cam followers that move in precisely machined bores in the crankcase. The base of the tappet can become severely pitted by acids in the combustion residue that has a presence inside the crankcase. Pitting and corrosion are prevalent when the engine is stored for long periods. This is particularly so if the engine is stopped while in a hot condition. Hot oil will drain easily from the camshaft and the base of the tappet, leaving the contact surfaces relatively dry and subject to condensation etc. If long periods of engine non-use are anticipated, it is a good idea to start the engine after it has cooled completely and run it for a few seconds so that cold engine oil is circulated, then the engine should be switched off for the storage period.

If the bases of the tappets are pitted and/or worn, they can be refaced and surface treated by a camshaft reconditioner. If this is done, the lobes on the camshaft should be re-profiled at the same time.

The lobes on the camshaft do not act upon the centre of the tappet, they are offset a small amount so that as the cam lobe rotates, the tappet also rotates as does the push rod.

The Javelin engine can be fitted with several styles of cam followers:

- a) The original hydraulic type.
- b) Solid type with low profile push rod seat. Requires longer push rod with larger diameter ball end at non-adjustable end.
- c) Solid type with shroud type push rod seat, to prevent push rod from dropping out during the situation of valve bounce. Requires longer push rod with larger diameter ball end at non-adjustable end. This is the preferred solid cam follower type.
- d) Solid type with extended pushrod seat to suit original length push rods with small diameter ball end. This was an Australian club modification.

In the case of items b), c) and d) above, the bronze push rod seat can become loose in the cam follower bore. This loose condition can cause excessive noise, a more hollow sound than common tappet rattle. The condition can be repaired by using Loctite primer and Loctite 680 adhesive. The components should be thoroughly cleaned, assembled with a smear of the Loctite 680 at the shank that fits into the cam follower bore. Both items are pushed together and lightly clamped in a soft jawed vice, to be held until the Loctite has fully cured. Be sure to clean off any Loctite residue, prior to cam follower installation – or severe damage can result.

Camshaft For Hydraulic Tappets

The camshaft used with hydraulic tappets had unique lobe profiles and lobe positioning on the shaft. Refer to *Technical Notes – Part III* for all information relating to the changes to camshafts. Should the type of camshaft not be known, it can be taken to a camshaft regrinding specialist who can assist and possibly convert it to solid tappet opening and closing ramp profiles.

The Rocker Arm Assembly

Inside the rocker covers, Part No. 50854, reside the rocker shaft assemblies. The rocker shaft is a hollow tube that is plugged at each end. There are two pillars that locate the shaft and rocker arms on the cylinder head. There is an oil feed via a banjo fitting at the No. 1 cylinder head stud to provide oil at the rocker arm bushes via small holes in the shaft. There are also drillings in the rocker arms to feed oil to the ball end of the push rod. This oil feed is important. Should there be no oil feed, the ball end of the push rod will become unevenly worn and cause problems during the valve clearance adjustment process.

There are four types of rocker arms in the complete assembly – off-set left and off-set right, for both inlet and exhaust valves.

Wear can take place at the cylinder head side of the rocker shaft, due to the cam lobe moving the cam follower and push rod upwards, against the force required to move the valve against its spring via the rocker arm. Wear in this area can cause fluctuations in the rocker arm to valve tip clearance (sometimes called tappet clearance). Most commonly, difficulty in setting the correct clearance can be attributed to wear at the rocker bush area.

Wear at the tip where contact is made with the valve stem can be repaired by having the rocker tips re-profiled. It is also possible to have the rocker tips Stellite hardened by a welding process. After the welding process the radius of the rocker tip should be carefully ground to match the centreline of the valve stem.

Valve Clearance Effects

The valve clearance in any engine, be it side valve, push rod overhead valve or overhead camshaft type, is of paramount importance to the longevity of the valve train. The valve clearance should be adjusted at 5,000 mile intervals. There are serious ramifications if this schedule is not maintained.

As the camshaft lobe rotates the valve is opened from its seated position. The profile of the cam lobe provides for an acceleration ramp, the initial valve opening sector, then there is the actual lift of the valve to its maximum open position. Up to this point, an excessively wide valve clearance does not have a detrimental effect on the mechanics of the system – apart from a ‘hammer blow’ at commencement of lift beyond the ramp. Another effect it can have, with very wide valve clearances, on an engine’s performance is that of late valve timing, indicated by lethargic engine pick-up from low idle and difficulty synchronising the carburettors, all related to a low vacuum reading at low idle.

From the maximum open position of the valve, and towards its closed position, is when the most damage can be experienced as the result of an excessively wide valve clearance. The valve closing ramp on the cam lobe has been carefully designed to control the rate of valve closure. It ensures that the valve is closed at a controlled rate, thus preventing damage caused by valve spring dynamism as the valve head contacts the valve seat.

If there is an excessively wide valve clearance, the valve head will ‘hammer’ hard against the valve seat, due to closing in an uncontrolled manner. The symptoms of this condition in petrol engines are, in severe cases, a condition called ‘tuliping’. This means that the valve’s seat surface has been bent away from the valve stem. If this condition is severe, an exhaust valve will burn away at the edge.

Uncontrolled valves can, in extreme cases, start to break up. Triangular pieces of the valve’s seat area can break out with ensuing damage to other components. A valve is machined from a forging, hence the aptness for breakage in this area, because of the metal’s grain characteristics. This concern mainly occurs in an engine that has been operating at higher temperatures than normal.

In the situation where the valve clearance is too small, or a minus amount, holding the valve part opened at all times, the exhaust valves will burn away quickly. There would also be, initially, poor engine performance. If the valve clearance at the inlet valves is too small, or the valve stays partly open, there could be flash-back through the carburettor. Engine starting would also be difficult.

The valve head and cylinder head seat area rely on contact with each other for cooling purposes as well as being able to maintain compression and combustion processes. Tight clearances at the rocker arm and valve stem can result in overheated valves.

An air/fuel mixture that is too weak can cause the engine to operate in an overheated condition, causing the exhaust valves to recess into the cylinder head seats and close the valve to rocker arm tip clearance. Retarded ignition timing can also generate the same symptom.

A benefit of regular maintenance of the valve clearance adjustment is that the inside of the engine, where sludge deposits etc accumulate, can be inspected and remedial action enacted promptly to resolve those concerns that may be found.

A great amount has been said and written in recent times about the issue of valve seat recession (VSR), but, there has not been comment about the importance of tappet clearance with respect to VSR. In all probability this was due to the fact that writers assume that valve train clearances are properly maintained. Another point to note is that as the valve seat recedes, the valve train clearance reduces, in effect a self fixing situation, but the recessive damage has already been done. It can be seen that maintenance of the valve clearances is of fundamental importance. Therefore it should be attended to at regular intervals, according to vehicle usage.

Investigating Valve Clearance Noise

Maintenance of the valve clearances is compounded by the fact that Jowett Cars Limited did not have a requirement that, with non-hydraulic tappets, the valve clearances be adjusted at a specified mileage interval. This situation can be easily remedied by using industry common service intervals such as every 5,000 miles or once a year, whichever comes first. With the use of unleaded petrol, maintenance of the valve clearances is of vital importance.

Investigation of excessive tappet noise should be carefully carried out. One condition that can cause symptom alarm, is if the noise is noted inside a garage with a sheet metal roof. Such a roof can amplify the noise quite considerably. Before any investigation can be executed, the valve clearances must be properly adjusted. This can be done employing the same method used by the factory, by setting zero clearance, i.e. with the push rods just spinning freely, with the engine cold. Setting the clearance in this manner can help identify valve noise, separately from the valve gear. This is not an uncommon method for making valve clearance adjustment on an engine with aluminium crank-case and steel valve train components.

However, the valve clearances should be adjusted using the procedure shown in the last Service Bulletin on the subject, issued by Jowett Cars Limited. It is reproduced in full below:

JOWETT CARS LIMITED – Bulletin Issue Date: March 1953

Item No. 131. Tappet Adjustment, Solid Type – Javelin and Jupiter

To clarify the instructions on tappet adjustment the following notes are issued. It is extremely important in view of the fine adjustment required that:

1. With the engine **COLD** the inlet clearance is set to 0.003-in. (0.076 mm) and the exhaust to 0.006-in. (0.152 mm) these dimensions being measured between the end of the valve stem and the rocker.
2. Ensure that the tappet being adjusted is riding on the base circle of the cam and **NOT** on the initial portion of the cam-quietening ramp.

These are two methods of obtaining the above conditions:

- a) Adjustment should be made to tappets according to the table shown below:

Setting Position of Engine Valve to be Adjusted

Number 1 Exhaust valve fully open	Adjust Number 2 Exhaust
Number 1 Inlet valve fully open	Adjust Number 2 Inlet
Number 3 Inlet valve fully open	Adjust Number 4 Inlet
Number 3 Exhaust valve fully open	Number 4 Exhaust
Number 2 Exhaust valve fully open	Adjust Number 1 Exhaust
Number 2 Inlet valve fully open	Adjust Number 1 Inlet
Number 4 Inlet valve fully open	Adjust Number 3 Inlet
Number 4 Exhaust valve fully open	Adjust Number 3 Exhaust

See chassis number plate on bulkhead to identify cylinder numbers.

- b) The alternative, the best method, is to deal with each valve individually. Obtain the fully open position of the valve, and then turn the crankshaft through one complete revolution; this will bring the valve in question to the fully closed position with the tappet on the base circle directly opposite the peak of the cam. **The favoured method used by the writer.**

End of Service Bulletin.

It should be noted that the above Service Bulletin has only recently come back into use. Thanks are due to Peter Jowett and the late Doug Anderson for downloading it from the Internet. It is a Service Bulletin that should be regarded as being current.

Final Comment

The adoption of this *modus operandi* for valve clearance adjustment will ensure a quiet running engine – providing the valve train is in good condition. ‘Expert’ opinion and advice on this procedure should be ignored. There have been many instances where so-called advice is adopted, with dire

consequences. A favourite is to make the adjustment when the other valve for that cylinder is fully opened. On a Jowett engine this simply does not work! In the case of valve clearance adjustment the Service Bulletin has to be considered as being absolutely correct. There is a situation where 'those in the know' do not understand the Jowett's valve train. This is the crux of the matter, because if an incorrect procedure is adopted, incorrect adjustment will definitely result.

The camshaft in the Jowett Javelin and Jupiter engine is centrally located and actuates valves located on opposing sides. This means that, even though the camshaft is short, it still flexes due to valve spring loads.

Most of our so-called 'experts' are probably familiar with inline or vee engines, where the majority of the valve spring load on the camshaft is from one direction only. On the Javelin and Jupiter engine the loads are from approximately 180° apart. This means that the camshaft is being loaded from side to side and upwards a little. If the correct valve clearance adjustment procedure is not used and the camshaft is out of its designated position for such adjustment, the actual valve clearance could be influenced by abnormal loads, resulting in noisy tappets when the engine is running.

Recently, the late Ken Lynn, while trying to quieten his Javelin's engine, carried out some investigations. Ken had been influenced by a 'knowledgeable one' and had adjusted the clearances to those shown in the book, by having one valve fully open and the other, on the same cylinder, closed. Further investigation by Ken, after examining the phasing of the cam lobes on a spare camshaft, revealed that, as the cam was rotated with the cam follower following the cam lobe's heel, the valve clearances varied considerably.

This caused him great alarm, followed by long telephone conversations to me. I checked a spare camshaft between two centres and found that between the finish of the closing ramps and the commencement of the opening ramps, run out was less than 0.0005-in. On a used camshaft such a dimension is insignificant.

So, what could be the cause of Ken's alarming findings? Simple really, flexing of the camshaft due to valve spring loads from the opposite bank of cylinders. The other cause of Ken's alarming measurements was probably wear at the camshaft bearing journals and their bores, thus permitting the camshaft to move sideways.

In the Javelin engine, bearing journal wear can take place at the sides of the crankcase bearing surfaces. The surfaces of the shaft journals can also wear. In severe cases, the camshaft can literally float from side to side, thereby causing variation at the valve clearances. Strangely, it has been found that more wear can exist at the surfaces of the centre bearing. This condition, during engine assembly, may not be noticed, but it can be the cause of noisy tappets once the engine has warmed to normal operating temperature.

What causes this wear?

Probably the most likely cause is unfiltered engine oil being fed to the bearings. Yes, the engine does have an oil filter – but, how often has it been serviced? That is the question. The old style filter using felt as the filtering medium was a good filter. However, being of the washable type, it probably lasted the life of the car, in the quest for saving on maintenance costs. No matter how carefully it was cleaned, some dirt probably ended up where it shouldn't have. The later paper element type was very good, but was probably subjected to abuse by neglecting to change it at regular intervals. Both types of filters featured element blockage protection devices, but that meant that when a blockage occurred at the oil filter element, unfiltered oil was fed to the vital parts. By-passing oil is not filtered at all, and the sad thing about this feature is that the driver is not aware when the element is being by-passed. Another point to beware of, with respect to the paper element type is that it should be changed at least once a year. Any older than that and the filtering paper may harden and not filter efficiently. Experience has shown that aged filter elements can, upon engine start-up, have pieces of the filtering medium break away – leaving openings for unfiltered oil to join the feed to vital engine parts.

If the car is only being used for short runs, corrosive combustion components build up in the lubricating oil and can cause problems in plain bearings. This is particularly so if the car is stored for lengthy periods. If this is the situation, then the engine oil and filter should be changed at shorter time intervals. The instruction books' schedules are only a guide for 'normal' operating conditions and service intervals should be adjusted accordingly.

In addition to all of this, oils in days past were not as good as they are now. Thus wear could have taken place at the camshaft bearing area. Older oils drained completely away from bearing surfaces when hot, resulting in dry starts if the car had stood idle for a long period. The load exerted by eight sets of valve springs on a dry camshaft is considerable so, during cold engine starts, some wear must take place. In fact, Caterpillar recommended hand pumping engine oil, via a plug provided, direct into the oil galleries of its 3208 diesel engine, if started after storage, to protect the camshaft bearing surfaces. Now, that is a cue for an interesting project!

As a result of the foregoing, it is now more important than ever to maintain those oil filters and valve clearances!
